

23801 E. La Palma Ave., Yorba Linda, CA 92887 Ph. 714.692.8180 Fax. 714.692.5016

www.cobrausa-vtwin.com

Items Supplied >	Application(s) >			
1 - RIGHT MUFFLER ASSEMBLY 1 - LEFT MUFFLER ASSEMBLY	HARLEY: TRI GLIDE	09-20		
2 - CLAMP, 27-61MSC		03-20		
Instruction Manual >	6301	Page 1 of 2		
Read all instructions carefully and complete	tely before installing your new Slip-On M	ufflers!		
 Remove and save the mounting hardware securing muffler clamps then pull the stock mufflers free fror 	the stock mufflers to the rear brackets. Loosen	the stock		
 Position the supplied 27-61MSC clamps with the he them onto the slip-on mufflers. 	ex head facing the ground as shown in Figure 1	and slide		
 Slide the mufflers onto the head pipes (Cobra logo is on the right muffler and should face outward) until the mounting holes align. 				
4. Fasten the mufflers using the stock mounting hardware in the same manner as stock but do not tighten.				
 Adjust the mufflers so that the muffler tip is flush withan 1/4" past the end of the rear valence. See Fig past the end of the rear valence the heat from the end. Also make sure the mufflers are not twisted around an even gap around the muffler as it exits through the end of the muffler as it exits through the end of the muffler as it exits through the end of the end	ure 3. If the mufflers are not flush with or do not exhaust may melt or distort the paint. If the centerline of the headpipes. Check to make	extend out		
ORIENT 27-61MSC CLAMPS WITH HEX HEAD AS SHOWN FIGURE 1	FIGURE 2	DE CLAMPS		
POSITION OF MUFFLERS AND MOUNTING BRACKETS SHOWN ABOVE MAY VARY FROM ACTUAL				
Continued on Page 2				
DISCLAIMER: NOT LEGAL FOR SALE OR USE IN CALIFORNIA ON A INSTALLATION OF THIS PRODUCT MAY ALSO BE ILLEGAL NATION	NY POLLUTION CONTROLLED MOTOR VEHICLE. THE SAI WIDE UNDER THE FEDERAL CLEAN AIR ACT (42 U.S.C.§ 7	LE, USE, OR /522(A)(3)).		
DOCUMENT NO. 0017 REV. A 01/20	¹ R	IDE LOUD ™		



23801 E. La Palma Ave., Yorba Linda, CA 92887 Ph. 714.692.8180 Fax. 714.692.5016

www.cobrausa-vtwin.com

Instruction Manual >		6301	Page 2 of 2
		B E. M	IUFFLER TIP MUST E FLUSH OR XTEND OUT NO IORE THAN A 1/4" AST REAR VALENCE
	FIGURE 3		
 Check all clearances and alignments the end of the muffler when tightened. collar the clamp will not tighten properly Tighten the mounting bolts to factory spectrum polish. Failure to do so can setting timing, etc., Cobra Engineer 	See Figure 2 . If the m y.) pecifications. ngine remove all fing cause chrome disco	uffler clamps are slid pas perprints from chrome w loration. Due to fluctuat	t the slots on the slip vith a quality wax or ions in fuel delivery